

SUTTLE

www.suttleonline.com

1-800-852-8662

CABLE SERIES: (red compression ring) rg59/rg59 quad
(green compression ring) rg6/rg6 quad

TOOL: SL-TOOL



SURE LOCK
connectors

1. Use a 1/4" x 1/4" cable prep tool. Assure that the braid is folded back onto the jacket as shown in Figure 1. If a color ring is going to be placed on the connector, slide it onto the cable before assembling the connector onto the cable.
2. This is a blind entry connector that requires a mark on the cable to insure proper cable insertion. Mark the cable length back from the end of the center conductor as shown in Figure 1, using a pen or thumbnail.


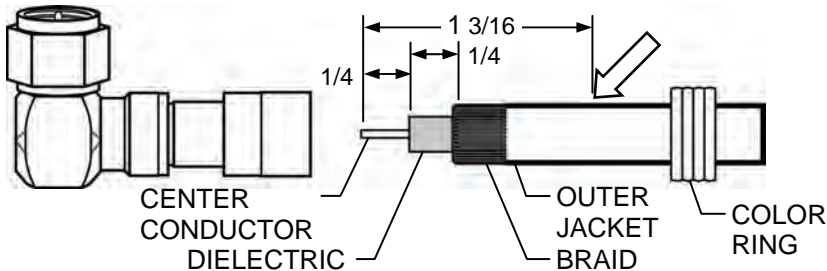


Figure 1 Cable prep

3. Snap the right angle tool tip into the spring clip on the plunger head of the SL-TOOL (shown in Figure 2). Place the connector and cable into the tool as shown in Figure 2. The top of the connector must be flat against the tool tip and the crimp ring of the connector will rest against the cable yoke. The connector must be parallel to the body of the tool.

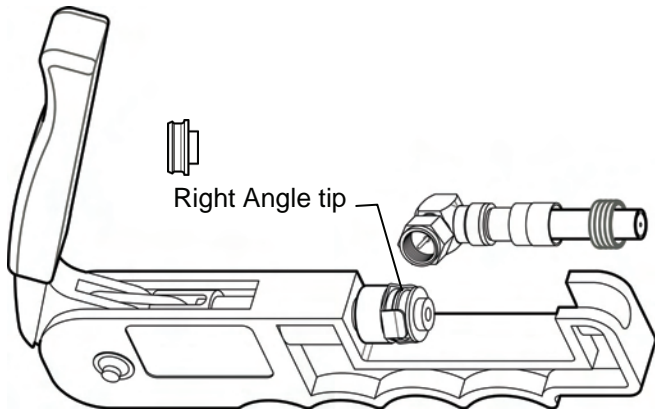

4. Press the tool until the handle closes completely against the body of the tool.

Figure 2 SL-TOOL